


**Trhací nýt s plochou hlavou**  
 Hlava OCEL/Zinek Bílý  
 TRN OCEL/Zinek Bílý



DIN: 7337A  
 ČSN: 02 2391  
 ISO:

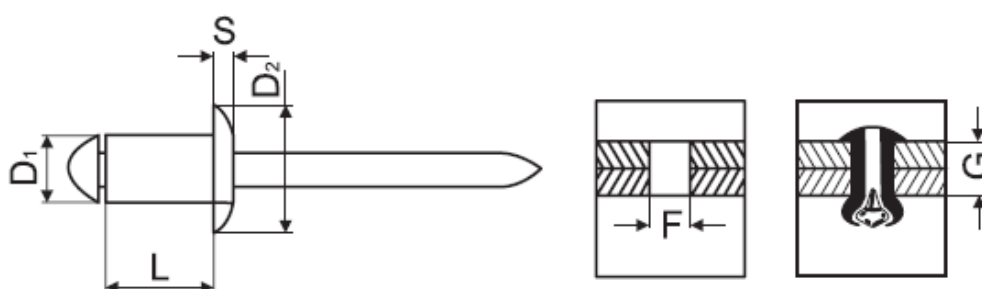

D1: 3,0mm D2: 6,5mm	D1xL	G Svěrná tl.	Pevnost v tahu	Pevnost na stříh	Kód Fastek
S: 0,8mm F: 3,1mm	3,0x5	0,5-1,5	1125N	915N	9NPS3005SS
	3,0x6	1,5-3,0			9NPS3006SS
	3,0x8	3,0-5,0			9NPS3008SS
	3,0x10	5,0-7,0			9NPS3010SS
	3,0x12	7,0-9,0			9NPS3012SS
	3,0x14	9,0-11,0			9NPS3014SS
	3,0x16	11,0-13,0			9NPS3016SS
	3,0x18	13,0-15,0			9NPS3018SS
	3,0x20	15,0-17,0			9NPS3020SS

D1: 3,2mm D2: 6,5mm	D1xL	G Svěrná tl.	Pevnost v tahu	Pevnost na stříh	Kód Fastek
S: 0,8mm F: 3,3mm	3,2x6	1,5-3,0	1285N	1060N	9NPS3206SS
	3,2x8	3,0-5,0			9NPS3208SS
	3,2x10	5,0-7,0			9NPS3210SS
	3,2x12	7,0-9,0			9NPS3212SS
	3,2x14	9,0-11,0			9NPS3214SS
	3,2x16	11,0-13,0			9NPS3216SS
	3,2x18	13,0-15,0			9NPS3218SS
	3,2x20	15,0-17,0			9NPS3220SS

<b>D1: 4,0mm D2: 8,0mm</b>	<b>D1xL</b>	<b>G Svěrná tl.</b>	<b>Pevnost v tahu</b>	<b>Pevnost na střih</b>	<b>Kód Fastek</b>
<b>S: 1,0mm F: 4,1mm</b>	4,0x6	1,5-2,5	1990N	1550N	9NPS4006SS
	4,0x8	2,5-4,5			9NPS4008SS
	4,0x10	4,5-6,5			9NPS4010SS
	4,0x12	6,5-8,5			9NPS4012SS
	4,0x14	8,5-10,5			9NPS4014SS
	4,0x16	10,5-12,5			9NPS4016SS
	4,0x18	12,5-14,5			9NPS4018SS
	4,0x20	14,5-16,5			9NPS4020SS
	4,0x22	16,5-18,0			9NPS4022SS
	4,0x24	17,0-20,0			9NPS4024SS
	4,0x25	17,5-22,5			9NPS4025SS
	4,0x26	18,0-23,0			9NPS4026SS
	4,0x30	22,0-27,0			9NPS4030SS

<b>D1: 4,8mm D2: 9,5mm</b>	<b>D1xL</b>	<b>G Svěrná tl.</b>	<b>Pevnost v tahu</b>	<b>Pevnost na střih</b>	<b>Kód Fastek</b>
<b>S: 1,1mm F: 4,9mm</b>	4,8x6	1,0-2,5	2920N	2300N	9NPS4806SS
	4,8x8	2,5-4,5			9NPS4808SS
	4,8x10	4,5-6,0			9NPS4810SS
	4,8x12	6,0-8,0			9NPS4812SS
	4,8x14	8,0-10,0			9NPS4814SS
	4,8x16	10,0-11,5			9NPS4816SS
	4,8x18	11,5-13,5			9NPS4818SS
	4,8x20	13,5-15,0			9NPS4820SS
	4,8x22	15,0-17,0			9NPS4822SS
	4,8x25	17,0-20,0			9NPS4825SS
	4,8x30	20,0-25,0			9NPS4830SS

<b>D1: 5,0mm D2: 9,5mm</b>	<b>D1xL</b>	<b>G Svěrná tl.</b>	<b>Pevnost v tahu</b>	<b>Pevnost na střih</b>	<b>Kód Fastek</b>
<b>S: 1,1mm F: 5,1mm</b>	5,0x10	4,0-6,0	3255N	2575N	9NPS5010SS
	5,0x12	6,0-8,0			9NPS5012SS
	5,0x14	8,0-10,0			9NPS5014SS
	5,0x16	10,0-11,5			9NPS5016SS
	5,0x18	11,5-13,5			9NPS5018SS
	5,0x20	13,5-15,0			9NPS5020SS
	5,0x22	15,0-17,0			9NPS5022SS
	5,0x25	17,0-20,0			9NPS5025SS
	5,0x30	20,0-25,0			9NPS5030SS

<b>D1: 6,0mm D2: 12,0mm</b>	<b>D1xL</b>	<b>G Svěrná tl.</b>	<b>Pevnost v tahu</b>	<b>Pevnost na střih</b>	<b>Kód Fastek</b>
<b>S: 1,5mm F: 6,1mm</b>	6,0x10	2,5-4,5	5000N	4000N	9NPS6008SS
	6,0x12	4,5-6,5			9NPS6012SS
	6,0x15	6,5-9,5			9NPS6015SS
	6,0x18	9,5-12,5			9NPS6018SS
	6,0x22	12,5-16,5			9NPS6022SS
	6,0x26	16,0-19,0			9NPS6026SS
	6,0x30	19,0-24,0			9NPS6030SS

<b>D1: 6,4mm D2: 13,0mm</b>	<b>D1xL</b>	<b>G Svěrná tl.</b>	<b>Pevnost v tahu</b>	<b>Pevnost na střih</b>	<b>Kód Fastek</b>
<b>S: 1,8mm F: 6,5mm</b>	6,4x8	1,0-3,0	5400N	4350N	9NPS6408SS
	6,4x10	2,0-4,0			9NPS6410SS
	6,4x12	3,0-6,0			9NPS6412SS
	6,4x15	6,0-9,0			9NPS6415SS
	6,4x18	9,0-12,0			9NPS6418SS
	6,4x22	12,0-16,0			9NPS6422SS
	6,4x26	16,0-20,0			9NPS6426SS
	6,4x30	20,0-24,0			9NPS6430SS